

Technical Bulletin

Date	Ref. No.	Model	BC			
22.03.02	TV01602	KV-29FX66E, KV-29FX66K, KV-29LS60B, KV-29LS60E, KV-29LS60K				
Subject						
East-West Distortion						

SYMPTOM


East-west distortion.

CAUSE

Q8803 on the D Board becomes defective after several hours of operation due to a breakdown of C5898 on the A Board.

SOLUTION

Replace C5898 "Ceramic Chip 0.001µF 10% 50V" (1-162-964-11) and Q8803 "2SC5698-CA" (8-729-056-16).

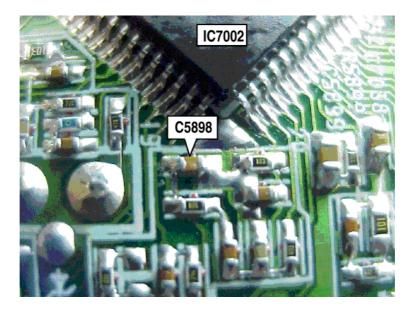

Flag	Symptom code	Part number	Ref. No.	Section code	PCB	Defect code	Repair code	Qty.	AE-6B
1	1335	1-162-964-11	C5898	DFL	Α	R	Α	1	
	1335	8-729-056-16	Q8803	DFL	D	Ν	Α	1	

Sony Service Centre (Europe) N.V. European Service Engineering Technologielaan 7 B - 1840 Londerzeel