

List of error messages

Error number on screen	Flashing LED							Description of error
								
1 ¹⁾			X		X	X		I ² C, IC7108, SSP [H] (MSM6307)
3					X	X	II	I ² C, IC7215, 100Hz [L] [L'] SAA9042
4				X			X	I ² C, IC7220, 100Hz [M] [L'] 83C652
5				X				I ² C, IC7408, PIP [J] (SDA9088)
6				X	X	X		I ² C, IC7600, SSP [F] (TDA8417)
7							X	I ² C, IC7680, SSP [F] (TDA8425)
8						X	X	IC7440, frame rotation [Z], PCF8574 (16:9)
9			X	X		X		I ² C, IC7430, SSP [D] (TDA4680)
10				X	X		X	I ² C, IC7395, SSP [D] (TDA8443)
11				X	X			I ² C, front-end, SSP [C] (FQ 9XX)
12						X		I ² C, IC7137, SSP [H] (X24C04)
13			X					I ² C, bus on chassis blocked
14			X	X				I ² C, IC7258, SSP [C] (HEF4094)
15			X	X	X			I ² C, IC7219, SSP [C] (TEA6414)
16			X			X		I ² C, IC7040, SAT Interface [P] (TEA6414)
17			X		X			IR-receiver on SSP [H] blocked (1100)
18				X		X	X	7115, SSP, μ proc. [H]
19			X	X	X	X		UART Bus blocked, 7115, SSP, μ proc. [H]
20				X	X	X	X	7115, SSP, μ proc. [H]
21				X				EAROM X24C04 empty, IC7137, SSP [H] (§ 8.3)
23	X				X			I ² C, IC7080, convergence panel [V] (TDA8444)
28		X						I ² C, PIP tuner [J]
29		X						I ² C, IC7638, PIP-modulo [J] (SAA1300)
30			X		X		X	I ² C, IC7175, SSP [C] (PCF8574)
31			X		X	X	X	I ² C, IC7001, NICAM-panel [K] (SAA7280)
33		X						I ² C, PLL (1500) PIP modulo [L]
34 ¹⁾	X		X				X	LNC supply on SAT box [Q,R] not correct
35 ¹⁾	X		X		X		X	IM-bus on SAT box [Q,S] blocked.
36 ¹⁾	X		X	X			X	I ² C, bus on SAT box blocked.
37 ¹⁾	X		X	X	X		X	I ² C, IC7450, D2-MAC [S] (X24C02)
38 ¹⁾	X		X			X	X	I ² C, SAT Tuner [Q] (SF914; SF916)
39 ¹⁾	X		X		X	X	X	HEF STROBE 1, IC7925, FSS [T] (HEF4094)
40 ¹⁾	X		X	X		X	X	D2-MAC [S]
41 ¹⁾	X		X	X	X	X	X	HEF STROBE 2, IC7475, D2-MAC [S] (HEF4094)
42 ¹⁾	X				X		X	IC7250, TUNER/CONTROL [Q]
43 ¹⁾	X			X			X	UART bus blocked IC7250, TUNER/CONTROL [Q].
44 ¹⁾	X			X	X		X	SAT Tuner [Q] (SF914/916)
45 ¹⁾	X					X	X	IC7250, TUNER/CONTROL [Q]
46 ¹⁾	X				X	X	X	IC7250, TUNER/CONTROL [Q]
47 ¹⁾	X			X		X	X	IC7262, TUNER/CONTROL [Q]
48 ¹⁾	X			X	X	X	X	D2-MAC [S]
49 ¹⁾	X			X		X		EAROM X24C02 empty, 7450, D2-MAC [S] (§17)
51 ¹⁾					X	X	X	IC7250, TUNER/CONTROL [Q]
52 ¹⁾			X				X	D2B Bus EXT, SSP [H] blocked.
53			X			X	X	IC7330, MAC TXT [S], TPU2735
55			X	X		X	X	IC7140, Panorama [B], PCF8574 (16:9)
99	X		X		X			Protection

¹⁾ This error is only possible on sets with built in SAT box.

In case an error indication on the set is not included in this table, then check the optional codes (see § 7).